


NOTE:

- 1 460V/60HZ TRANSFORMER (1T1) SHOWN. SEE INSET "A" FOR OTHER VOLTAGE CONNECTIONS.
- 2 FUSES (1F12 & 1F13) & WIRES 163A,164A,305E,306E ARE USED WITH ALL VOLTAGES EXCEPT, 575 VOLT. ON 575V UNITS CONNECT WIRES 305F AND 306F DIRECTLY TO TRANSFORMER (1T1).
- 3 WIRES "W40" & "W41" REQUIRED ONLY WITH LOW AMBIENT DAMPER OPTION.
- 4 FOR 380V/415V/50HZ APPLICATIONS CUT JUMPER WIRE ON 1U3 PHASE MONITOR.
- 5 1K10, 1K14 AND ASSOCIATED WIRING USED ONLY ON 100 & 120 TON UNIT CONTROL BOXES.
- 6 NOTE SYMBOL  USED WITH 200/230V UNITS. SYMBOL  USED FOR 460/575V UNITS.

INSET A (OPTIONAL TRANSFORMER CONN)

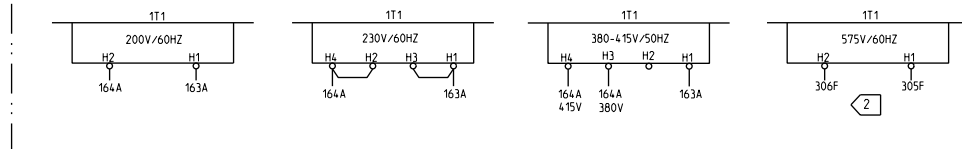

TRANE		FILE NUMBER:	DRAWING NUMBER:	SHEET:	REV
THIS DRAWING IS PROPRIETARY AND SHALL NOT BE COPIED OR ITS CONTENTS DISCLOSED TO OUTSIDE PARTIES WITHOUT THE CONSENT OF TRANE.			2307-9217	1 OF 1	A
DRAWN BY: D. SHANNON		TRANE® DATE: 3-28-11		SPLIT SYSTEM CONDENSING UNIT	
REPLACES: 2307-9141-D		REVISION DATE: --		DIAGRAM	
CAD SYSTEM USED: PRO/DETAIL		SIMILAR TO: --		CONNECTION - AIR COOLED - CONTROL BOX - AREA 1	
				RA 80-120 TON - CONNECTION 1 OF 3	

