

NOTES:

- 1 ALL WIRING AND DEVICES SHOWN DASHED TO BE SUPPLIED AND INSTALLED BY THE CUSTOMER IN ACCORDANCE WITH LOCAL AND NATIONAL ELECTRICAL CODES.
- 2 IF ANY OF THE ORIGINAL WIRE, AS SUPPLIED WITH THIS UNIT, MUST BE REPLACED, REPLACE IT WITH APPLIANCE WIRING MATERIAL RATED AT 105°C.
- 3 THREE PHASE MOTORS ARE PROTECTED UNDER PRIMARY SINGLE PHASING CONDITIONS. ALL MOTORS HAVE INTERNAL OVERLOAD PROTECTION. COMPRESSORS HAVE INTERNAL THERMAL PROTECTION.
- 4 REQUIRED FOR OPTIONAL REFERENCE ENTHALPY CONTROL.
- 5 REQUIRED FOR OPTIONAL COMPARATIVE ENTHALPY CONTROL.
- 6 OPTIONAL MAS, RAS, RHS, OHS AND ASSOCIATED WIRING NOT USED WITH MOTORIZED OUTSIDE AIR.
- 7 COMPRESSOR CONFIGURATION FOR 20 TON UNITS WITH OPTIONAL DEHUMIDIFICATION.
- 8 WHEN ELECTRIC HEAT OPTION IS REQUIRED, REFER TO ELECTRIC HEAT DIAGRAM FOR CUSTOMER CONNECTIONS.

WIRE COLOR DESIGNATION			
ABBR	COLOR	ABBR	COLOR
BK	BLACK	V (PR)	PURPLE
BL	BLUE	R	RED
BR	BROWN	TN	TAN
G	GREEN	W	WHITE
O	ORANGE	Y	YELLOW

IMPORTANT!
DO NOT ENERGIZE UNIT
UNTIL CHECK-OUT AND
START-UP PROCEDURE HAS
BEEN COMPLETED.

TRANE	
THIS DRAWING IS PROPRIETARY AND SHALL NOT BE COPIED OR ITS CONTENTS DISCLOSED TO OUTSIDE PARTIES WITHOUT THE CONSENT OF TRANE.	
DRAWN BY: D. SHANNON	TRANE® DATE: 3/16/12
REPLACES: 2313-1443-B	REVISION DATE:
CAD SYSTEM USED: PRO/DETAIL	SIMILAR TO:

FILE NUMBER:	DRAWING NUMBER:	SHEET:	REV
2313-1513	2313-1514	1 OF 1	A
VOYAGER 2 DIAGRAM CONNECTIONS - RACEWAY COOLING ONLY - 200-575 VAC CONSTANT VOLUME			

CAUTION

USE COPPER CONDUCTORS ONLY!

UNIT TERMINALS ARE NOT DESIGNED TO ACCEPT OTHER TYPES OF CONDUCTORS.

FAILURE TO DO SO MAY CAUSE DAMAGE TO THE EQUIPMENT.

PRECAUCIÓN

N'UTILISER QUE DES CONDUCTEURS EN CUIVRE!

LES BORNES DE L'UNITÉ NE SONT PAS CONÇUES POUR RECEVOIR D'AUTRES TYPES DE CONDUCTEURS.

L'UTILISATION DE TOUT AUTRE CONDUCTEUR PEUT ENDOMMAGER L'ÉQUIPEMENT.


ATTENTION

¡UTILICE ÚNICAMENTE CONDUCTORES DE COBRE!



LAS TERMINALES DE LA UNIDAD NO ESTÁN DISEÑADAS PARA ACEPTAR OTROS TIPOS DE CONDUCTORES.

SI NO LO HACE, PUEDE OCASIONAR DAÑO AL EQUIPO.

INDOOR SECTION

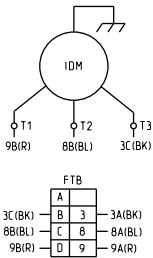

HEAT SECTION

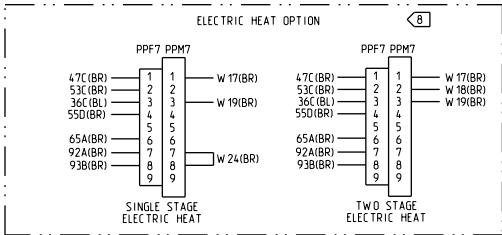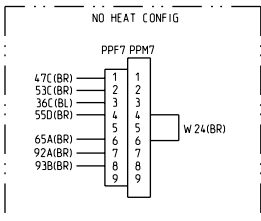

OUTDOOR SECTION

